



Firmware Version: 1.03rc098

Published Date: 2016/10/07

Content:

New Features:.....	2
Changes of MIB & D-View Module:.....	2
Problems Fixed:	2
Known Issues:	3
Related Documentation:	3

Revision History and System Requirement:

software Version	Date
1.00r033	2014/09/23
1.01r053	2015/01/09
1.02rc068	2015/06/16

New Features:

- 1 Captive portal with Multiple SSID and VLAN
- 2 Payment gateway(Paypal)
- 3 Hotspot printing
- 4 External captive portal
- 5 Support AP load balancing
- 6 SSID on/off by scheduling
- 7 Country selection
- 8 Manual channel selection on CWM
- 9 Allow CWM admin(root, local, frontdesk) to input password as special characters(/,\,|,*,?,:,~!,#,\$,%,^,&,+,=" + "<, >,'&)
- 10 The online user is up to 100(CWM)
- 11 The AP modules are embedded in CWM program
- 12 The connected client system detection (Android,windows..etc)
- 13 Add more measure items(bps /Bps / KBps/ MBps /GBps) in reporting page
- 14 Add AP link down alarm in CWM(Sending email to admin)
- 15 CWM management port(SSL) customization
- 16 Add enable/disable selection on CWM CAPTCHA function
- 17 ACL list import function
- 18 The MAC ACL number limitation is 512 per radio(The original is 64 per SSID)
- 19 Add Performance and Wireless resource settings from AP to CWM

Changes of AP Module:

CWM_DAP2230 v1.00-R01-FWv100rc002
 CWM_DAP2310B v2.05-R23-FWv205rc024
 CWM_DAP2330 v1.05-R15-FWv105rc019
 CWM_DAP2360B v2.05-R18-FWv205rc031
 CWM_DAP2553B v3.05-R11-FWv305rc019
 CWM_DAP2660 v1.10-R33-FWv110rc042
 CWM_DAP2690B v3.15-R33-FWv315rc082
 CWM_DAP2695 v1.15-R37-FWv115rc049
 CWM_DAP3320 v1.00-R02-FWv100rc006
 CWM_DAP3662 v1.01-R05-FWv101rc019

Problems Fixed:

Software Version	Problems Fixed
V1.03	1. The captive portal page will not be displayed when default home page is https page.

	<ol style="list-style-type: none"> 2. Fixed 403 error when using Firefox 3. Fixed use customization page source from CWM1.03 pages_license.tar (modify for customization) can review and display but after authentication Web UI display 'Not Found' and could not connect to internet. 4. Fixed use customization page source from CWM v1.02 can review and display but after enter passcode Web UI display 'Not Found' and could not connect to internet. 5. Fixed none Profile page is displayed on Monitor>Monitor list page. (Click Monitor list button would not redirect to anyone profile page.) 6. Fixed while 2.4G SSID and 5G SSID are different or Multi SSID is enabled, Band Steering should not be enabled by CWM. This cause wireless client is difficult to connect to AP by 2.4G.
--	---

Known Issues:

Software Version	Known Issues
V1.03	<ol style="list-style-type: none"> 1. Use customization page source from CWM v1.02 can review and display but after enter passcode Web UI display 'Not Found' and could not connect to internet. User need to upload their source file into CWM v1.03 and apply again. 2. [Performance]: Show wrong data rate in 5GHz. 3. [SSID-> User Authentication -> Paypal]: The passcode list table not list the time purchased by user. 4. [Multi-language]: some translate error in Multi-language. 5. [Front Desk Staff]: The station still can access the Internet when passcode been deleted 6. DWP-2360 (for China only) module will release soon

Related Documentation:

Central WifiManager_100_Manual_v1.03